


2013 Ford Galaxy 2.0 TDCi 138 BHP Titanium A Galaxy 2.0 TDCi 138 BHP Titanium A VIN # 132D13878

290303 KILOMETRES	MPV	- -	- AUTOMATIC
----------------------	-----	--------	----------------

INSPECTION LOCATION: EXT: GREY INT: -

INSPECTION DATE:  
AUGUST 15, 2022 @ 10:46

BODY:



GLASS:



PART:



DISCLOSURES:

0

Vehicle Photos

ORIGINAL INSPECTION

Upload Photos

OPTIONAL

No photo

Interior (1)

No damage









Exterior (19)

LEFT SIDE





Info Info Severe

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD
Left Rocker Panel		Has Multiple Major Scratches - Not Through Paint	10 or more scratches	Repair & Refinish
Front Left Fender		Has Minor Scratches - Not Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Repair & Refinish






 










RIGHT SIDE

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD
 Front Right Door		Has Major Dent - Not Through Paint	9 inches to 10 inches	Replace
 Right Rocker Panel		Has Multiple Minor Scratches - Not Through Paint	2	Refinish
 Front Right Door		Has Medium Dent - Not Through Paint	5 to 6 inches	Repair & Refinish
 Rear Right Door		Has Major Scratches - Not Through Paint	9 inches to 10 inches	Repair & Refinish
 Right Quarter Panel		Has Multiple Minor Scratches - Not Through Paint	2	Refinish
 Rear Right Door		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair
 Rear Right Door		Has Medium Dent - Not Through Paint	5 to 6 inches	Repair & Refinish

FRONT SIDE

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD
 Front Bumper Cover		Has Multiple Minor Scratches - Not Through Paint	2	Refinish
 Front Bumper Cover		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair

REAR SIDE

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD
 Trailer Hitch		Has Major Rust	> 6 inches	Replace
 Rear Bumper Cover		Has Minor Scratches - Not Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Repair & Refinish
 Rear Bumper Cover		Has Medium Scrape	5 to 6 inches	Repair & Refinish
 Rear Bumper Cover		Has Minor Scratches - Not Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Repair & Refinish
 Rear Bumper Cover		Has Multiple Minor Scratches - Not Through Paint	2	Refinish
 Rear Bumper Cover		Has Small Crack	1/8 to 1/2 inch - NAAA Acceptable	Replace
 Rear Hatch		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair
 Rear Bumper Cover		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	Repair & Refinish

WINDSHIELD

No damage