

English Français

**2009 BMW 3 SERIES** 4dr Sdn 323i RWD

VIN # **WBAPG735\*A\*\*\*1024**

248776 KILOMETRES	Sedan 4 Dr.	2.5 liters -	Rear Wheel Drive AUTOMATIC
----------------------	-------------	-----------------	-------------------------------

EXT: Jet Black

INT: Black



INSPECTION DATE:  
SEPTEMBER 22, 2022 @ 18:07

BODY:




GLASS:




PART:



TIRES:



WHEELS:



DISCLOSURES:



**Vehicle Photos**



ORIGINAL INSPECTION

**Upload Photos**

OPTIONAL

No photo

**Total Chargeable Damages :**

Chargeable Excess Wear and Tear: \$5552.50

Items With Diagnosis Required: 0

**Total Known Chargeable: \$5552.50**

**Total Chargeable: \$5552.50**

PLEASE NOTE:

This is a preliminary inspection report and not a final invoice. If you purchased excess wear & use protection, the applicable coverages would be applied at the time of vehicle turn-in, and a final maturity invoice will then be generated. Please ensure that all necessary repairs are completed at an authorized repair facility before returning the vehicle.

**Interior (0)**

No damage

**Exterior (25)**

LEFT SIDE

Info ● ● ● ● Severe

Normal Wear

TIRES & WHEELS:

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<span style="color: blue;">●</span> Front Left Tire		Is Minor Worn	Minor Signs of Wear	Info/Report	\$0.00	\$0.00	\$0.00
<span style="color: blue;">●</span> Rear Left Tire		Is Minor Worn	Minor Signs of Wear	Info/Report	\$0.00	\$0.00	\$0.00

Excess Wear

EXTERIOR:

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<span style="color: yellow;">●</span> Rear Left Door		Has Medium Scrape	5 to 6 inches	Refinish	\$150.00	\$200.00	\$350.00
<span style="color: yellow;">●</span> Left Quarter Panel		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair	\$187.50	\$0.00	\$187.50
<span style="color: yellow;">●</span> Rear Left Door		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair	\$187.50	\$0.00	\$187.50

RIGHT SIDE

Info ● ● ● ● Severe

Normal Wear

TIRES & WHEELS:

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<span style="color: blue;">●</span> Rear Right Tire		Is Minor Worn	Minor Signs of Wear	Info/Report	\$0.00	\$0.00	\$0.00
<span style="color: blue;">●</span> Front Right Tire		Is Minor Worn	Minor Signs of Wear	Info/Report	\$0.00	\$0.00	\$0.00

Excess Wear

TIRES & WHEELS:

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
-----------	---------------	-------------	----------	---------------	-------	-------------------	-------

<b>Front Right Wheel</b>		Has Minor Curb Rash	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$75.00	\$20.00	\$95.00
<b>Rear Right Wheel</b>		Has Minor Curb Rash	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$75.00	\$20.00	\$95.00

**EXTERIOR:**

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<b>Front Right Door</b>		Has Minor Scratch - Not Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$150.00	\$200.00	\$350.00
<b>Rear Right Door</b>		Has Major Dent - Through Paint	9 inches to 10 inches	Replace	\$525.00	\$950.00	\$1475.00
<b>Right Quarter Panel</b>		Has Major Scratch - Through Paint	9 inches to 10 inches	Repair & Refinish	\$450.00	\$250.00	\$700.00
<b>Right Quarter Panel</b>		Has Minor Dent - Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$187.50	\$225.00	Included
<b>Rear Right Door</b>		Has Minor Dent - Through Paint	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$150.00	\$200.00	Included
<b>Right Quarter Panel</b>		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair	\$187.50	\$0.00	Included

**FRONT SIDE**

Info Severe

**Normal Wear**

**EXTERIOR:**

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<b>Front Right Head Light</b>		Is Dull And Foggy	Very Dull	Replace	\$0.00	\$0.00	\$0.00
<b>Front Left Head Light</b>		Is Dull And Foggy	Very Dull	Replace	\$0.00	\$0.00	\$0.00
<b>Front Right Fog Light</b>		Is Dull And Foggy	Very Dull	Replace	\$0.00	\$0.00	\$0.00
<b>Front Left Fog Light</b>		Is Dull And Foggy	Very Dull	Replace	\$0.00	\$0.00	\$0.00

**Excess Wear**

**EXTERIOR:**

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
-----------	---------------	-------------	----------	---------------	-------	-------------------	-------

<b>Front Bumper Cover</b>		Has Medium Scrape	5 to 6 inches	Refinish	\$150.00	\$200.00	\$350.00
<b>Front Bumper Cover</b>		Has Multiple Minor Scratches - Not Through Paint	2	Refinish	\$150.00	\$200.00	\$350.00
<b>Hood</b>		Has Medium Dent - Not Through Paint	5 to 6 inches	Refinish	\$187.50	\$225.00	\$412.50
<b>Hood</b>		Has Minor Dent - Not Through Paint	1/8 to 1 inch - NAAA Acceptable	PDR Repair	\$187.50	\$0.00	\$187.50

REAR SIDE

Info Severe

Excess Wear

EXTERIOR:

COMPONENT	CROPPED PHOTO	DAMAGE TYPE	SEVERITY	REPAIR METHOD	LABOR	PARTS & MATERIALS	TOTAL
<b>Rear Bumper Cover</b>		Has Minor Peeling	1/8 to 1/2 inch - NAAA Acceptable	Refinish	\$150.00	\$200.00	Included
<b>Rear Bumper Cover</b>		Misaligned	Component is misaligned	Replace	\$262.50	\$550.00	\$812.50

WINDSHIELD

No damage

Tires & Wheels


- Like New
- Good Condition
- Medium Worn
- Major Worn
- Snow Tire

**LEFT FRONT**

Is Minor Worn

Minor Signs of Wear

8/32, 7/32, 6/32

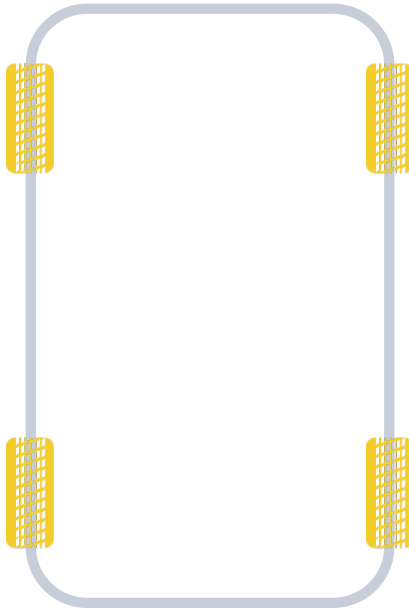

**RIGHT FRONT**

Is Minor Worn

Minor Signs of Wear

8/32, 7/32, 6/32

**LEFT REAR**

Is Minor Worn

Minor Signs of Wear

8/32, 7/32, 6/32

**RIGHT REAR**

Is Minor Worn

Minor Signs of Wear

8/32, 7/32, 6/32